




型号

型号	螺纹代码	螺纹类型	丝杆直径 mm	导程 mm	螺纹数	配套电机	螺栓圈 mm	安装孔直径 mm
LSNUT-AAAA-TDBA	TDBA	消隙螺母	3.5	1	1	LSA-...-TDBA	12.7	3.2
LSNUT-AAAA-UGAQ	UGAQ	ACME 螺纹	4.76	0.635	1	LSA-...-UGAQ	12.7	3.2
LSNUT-AAAA-UGFC	UGFC	ACME 螺纹	4.76	5.08	4	LSA-...-UGFC	12.7	3.2
LSNUT-AAAA-THCA	THCA	消隙螺母	5	2	1	LSA-...-THCA	12.7	3.2
LSNUT-AAAAE-UIAP	UIAP	ACME 螺纹	5.56	0.6096	1	LSA-...-UIAP	19.05	3.6
LSNUT-AAAAE-TJBA	TJBA	消隙螺母	6	1	1	LSA-...-TJBA	19.05	3.6
LSNUT-AAAAE-TJCA	TJCA	消隙螺母	6	2	2	LSA-...-TJCA	19.05	3.6
LSNUT-AAAAE-UKAS	UKAS	ACME 螺纹	6.35	0.794	1	LSA-...-UKAS	19.05	3.6
LSNUT-AAAAE-UKBN	UKBN	ACME 螺纹	6.35	1.588	1	LSA-...-UKBN	19.05	3.6
LSNUT-AAAAE-UKDE	UKDE	ACME 螺纹	6.35	3.175	2	LSA-...-UKDE	19.05	3.6
LSNUT-AAAAE-UKGI	UKGI	ACME 螺纹	6.35	6.35	4	LSA-...-UKGI	19.05	3.6

尺寸图 (单位MM)

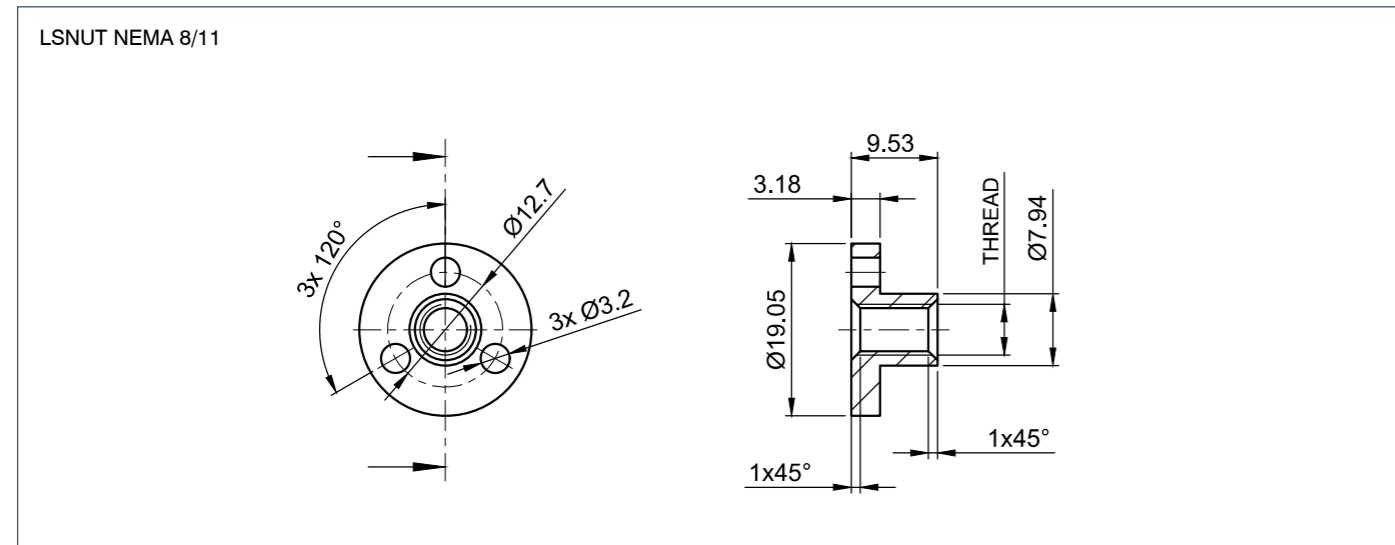

尺寸图 (单位MM)

